
# Your Flow Meter Redefined

Introducing our all-in-one gas mass flow meter







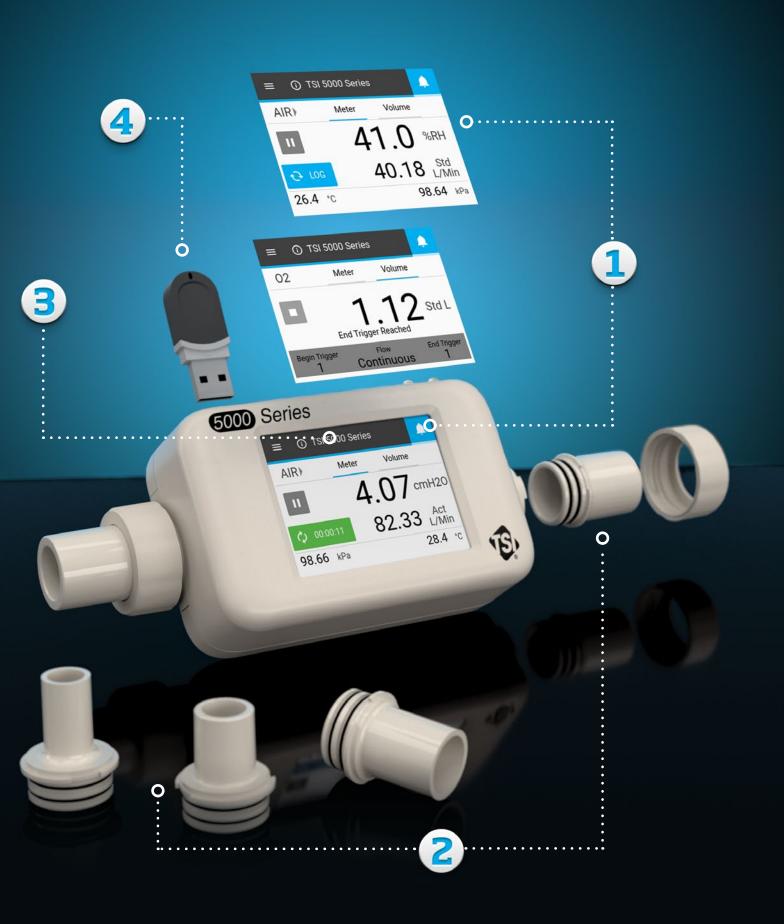

#### Multiple Integrated Measurements

Flow | Temperature | Absolute Pressure | Volume | Low Differential Pressure | Humidity The measurements you need, in one device.

Our all-in-one Flow Meter offers the option to combine flow, temperature, absolute pressure, volume, low differential pressure, and humidity measurements in a single device. In addition to simplifying your test setup, you are also saving time and money by not purchasing and maintaining multiple instruments.



Let our new flow meter fit your unique application.

Our new all-in-one Flow Meter fits into your test setup, with its user-configurable tube ends, wide operating range, and lightweight, compact design.

| 2 |   |
|---|---|
| 2 | 1 |
|   | 3 |

Easy to Use Touchscreen Display

Quickly and easily configure measurements and device settings directly from the flow meter's large, color touchscreen display.

You can also view up to four readings simultaneously, as well as pause the display to record readings or log the data directly to the instrument.



Built-In Data Logger Save your data to the meter and easily export it using the USB port.

With the 5000 Series, datalogs are saved as CSV files with all measurement data automatically synchronized, which can be exported using a USB flash drive or connected directly to the FLO-Sight<sup>m</sup> software.







#### Operate with FLO-Sight<sup>™</sup> PC Software

Use our FLO-Sight Companion Software to do even more with your Meter.

Unlock additional functionality such as viewing real-time graphs, displaying min/max/average data, naming and organizing your flow meters for easier recognition, logging data directly to the computer, setting alarms, and more.

## Make the Measurements You Need

Our new flow meter provides bi-directional flow sensing with a best-in-class turndown ratio.

This means you can measure a wide range of flow rates in both directions with a single meter, and is especially useful if your full flow range is unknown or fluctuates widely.

# Calibrated and Compensated

For each meter, TSI performs a 10 point NIST-traceable calibration across its entire flow range.

All Meters are compensated to provide a mass flow output independent of temperature and pressure. Some models of the 5000 Series can also compensate for humidity to provide the equivalent dry gas flow.

## **Features**

- + 4 millisecond bi-directional flow response
- + High accuracy (±2% of reading, ±1.7% of reading optional)
- + Low pressure drop minimizes flow back pressure
- + Wide dynamic operating range (1000:1 turndown ratio)
- + Multiple gas calibrations available, user-selectable
- + Measure up to 6 parameters with a single instrument
- + Display four measurement parameters simultaneously
- + 2.8 inch color touchscreen operation
- + Configurable tube end connectors
- + Data logging options
- + USB power and data communications
- + Temperature and pressure compensated, optional humidity compensation
- + 10 Point NIST-traceable Calibration Certificate included
- + Comes with FLO-Sight PC software (basic version)

## Industries

- + Medical Device Manufacturing and Service - Ventilators, CPAPs, Anesthesia workstations,
- + Light Industrial
- Valves, pumps, fittings, tubings, regulators, etc.
- + Environmental
- Sampling pumps
- Air sampling instrumentation
- + Research & Analytical
- + Aerosol Science

# **Proven** Performance

Our new all-in-one flow meter is built with the same proven technology that's been relied upon for 35+ years.

The 5000 Series utilizes our proprietary platinum film sensor design for measuring gas flows where high accuracy, fast response, and low pressure drop are performance must-haves.



5300 Series

11

24.7 %

TSI High Flo

193.18 Std

201.69 Act

98.21 kPa

B.

# **Applications**

Researchers, engineers, designers, and scientists use TSI Gas Flow Meters in a variety of applications such as:

- + Quality Assurance

- + Field Service

6200 Series



# **FLO-Sight PC Software**

Get the most out of your new all-in-one TSI Flow Meter with FLO-Sight PC Software, our 5000 Series companion software.

You can now couple the real time analytics and data visualization of FLO-Sight software with the industryleading response rate and ultra-low pressure drop of our 5000 Series Flow Meters to gain valuable insights and truly understand your flows.

Optional FLO-Sight basic software is included with the purchase of a 5000 Series Multi-Meter and provides these features:


- + Real-time display of all measurement parameters including totalizer
- + Min, max, and average readings
- + Advanced meter configuration

Optional FLO-Sight advanced software features include:

- + Real-time graphing
- + Data logging, download, and file management
- + Alerts set for any parameter
- + Multiple meter operation


A free trial of FLO-Sight software's advanced features is included with the Series 5000 Flow Meter. The advanced version can be purchased through the software itself or at **www.tsi.com**.

#### See your flows as you've never seen them before with FLO-Sight software.

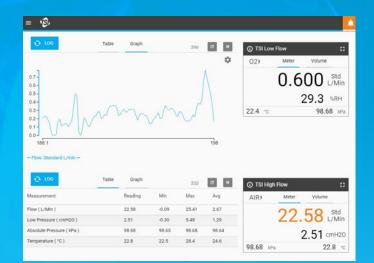


# **Proven Performance**

All TSI meters come with our unique platinum film sensor, providing highly accurate readings, fast response time, and low pressure drop.

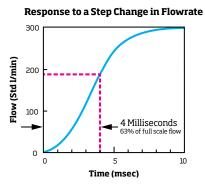


#### Fast

Fast 4 millisecond response ensures accuracy in fluctuating flows. This fast response is ideal for closed-loop control systems and integrated volume measurements. Pressure and temperature measurements are also extremely fast.

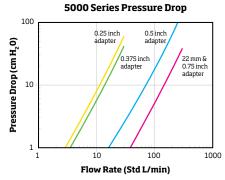

#### Low Pressure Drop

Low pressure drop minimizes flow circuit back pressure and its impact on the system under test.

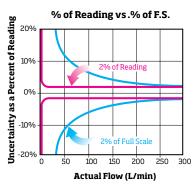

#### Accurate

A flowmeter specified as  $\pm 2\%$  of full scale is most accurate at full scale. If full scale is 300 L/min, then the uncertainty for all readings is  $\pm 6$  L/min. TSI flow meters are specified as  $\pm 2\%$  of reading and have an uncertainty of  $\pm 2\%$  of the actual reading from full scale all the way down to a specified lower limit. TSI flow meters, therefore, provide dependable accuracy over a wide range of flow rates. One TSI flowmeter covers the same range as three or more "percent of full scale" devices... with better accuracy at all points!

# **Model Selection Guide**

Step 1

Step

| What is the range of your flows?               | 5200 Series                        |  | 5300 Series                                      |   |   |
|--|------------------------------------|--|--|---|---|
| Flow Range                                     | 0-30 Std L/min                     |  |  | 0-300 Std L/                            | min                                     |
| What features<br>do you want?                  | <b>Base Models</b><br>(5200, 5300) | <b>Advanced</b><br><b>Models</b><br>(5210, 5310) | <b>Humidity</b><br><b>Models</b><br>(5220, 5320) | High Accuracy<br>Models<br>(5230, 5330) | Wide Accuracy<br>Models<br>(5203, 5303) |
| Flow, Totalizer<br>Measurements                | +                                  | +  | +  | +                                       | +                                       |
| Temperature, Absolute<br>Pressure Measurements | +                                  | +  | +  | +                                       | +                                       |
| Volume Measurement<br>(Displayed on screen)    |                                    | +  | +  | +                                       |   |
| Differential Pressure<br>Measurement           |                                    | +  | +  | +                                       |   |
| Data Logging                                   |                                    | +  | +  | +                                       |   |
| Relative Humidity<br>Measurement               |                                    |  | +  | +                                       |   |
| Humidity Compensation                          |                                    |  | +  | +                                       |   |
| Higher Accuracy<br>(1.5% of reading)           |                                    |  |  | +                                       |   |
| Wide Accuracy Spec<br>(3% of reading)          |                                    |  |  |   | +                                       |



| What gases need to be measured? | Air, N <sub>2</sub> | Air, O <sub>2</sub> ,<br>Air/O <sub>2</sub> mix, N <sub>2</sub> | Air, CO <sub>2</sub> , N <sub>2</sub> | O₂ Only | CO₂ Only |
|---------------------------------|---------------------|---|---------------------------------------|---------|----------|
| 5200 Series Low Flow            |                     |   |                                       |         |          |
| Base Models                     | 5200-1              | 5200-2  | 5200-3                                | 5200-6  | 5200-7   |
| Advanced Models                 | 5210-1              | 5210-2  | 5210-3                                | 5210-6  | 5210-7   |
| Humidity Model                  |                     | 5220-2  |                                       |         |          |
| High Accuracy Model             |                     | 5230-2  |                                       |         |          |
| Wide Accuracy Spec Model        |                     | 5203-2  |                                       |         |          |
| 5300 Series High Flow           |                     |   |                                       |         |          |
| Base Models                     | 5300-1              | 5300-2  | 5300-3                                | 5300-4  | 5300-5   |
| Advanced Models                 | 5310-1              | 5310-2  | 5310-3                                | 5310-4  | 5310-5   |
| Humidity Model                  |                     | 5320-2  |                                       |         |          |
| High Accuracy Model             |                     | 5330-2  |                                       |         |          |
| Wide Accuracy Spec Model        |                     | 5303-2  |                                       |         |          |

# To see an interactive model selection guide,

Please visit our online tool at tsi.com/5000-Series-Flow-Meters/Selection-Guide

# Accessories



| Description                              | Part Number |
|--|-------------|
| Inlet Filter - Low Pressure              | 5300-IF-LP  |
| Inlet Filter - High Pressure             | 5300-IF-HP  |
| 22mm M to 15mm F ISO Tube Ends (2)       | 5300-22MM   |
| 1/2 Inch Tube Ends (2)                   | 5300-05IN   |
| 15mm ISO Tube Ends (2)                   | 5300-15MM   |
| 3/4 Inch Tube Ends (2)                   | 5300-075IN  |
| High Pressure 3/8 Inch NPT Tube Ends (2) | 5300-375NPT |
| High Pressure Kit                        | 5300-HPK    |



| Description                          | Part Number    |
|--------------------------------------|----------------|
| Inlet Filter 3/8 Inch - Low Pressure | 5200-IF-0375IN |
| Inlet Filter 1/4 Inch - Low Pressure | 5200-IF-025IN  |
| 3/8 Inch Tube Ends (2)               | 5200-0375IN    |
| 1/4 Inch Tube Ends (2)               | 5200-025IN     |
| 10mm Tube Ends (2)                   | 5200-10MM      |



| Description                              | Part Number   |
|--|---------------|
| Tabletop Stand                           | 5000-TTS      |
| USBC to USB-A Cable with Screw Lock      | 5000-USB-LOCK |
| USB-RS232 Communications Cable           | 5000-RS232    |
| USB Hub Cable                            | 5000-HUB      |
| Wall Mounting Kit                        | 5000-WMK      |
| Wall Mounting Din Rail Kit               | 5000-WMDRK    |
| Deluxe Carrying Case                     | 5000-DCC      |
| FLO-Sight PC Software (Advanced Version) | 5000-PC-ADV   |

# To Order a Flow Meter or Any of Our Accessories

Please visit our website at **tsi.com/5000-Series-Flow-Meters** and place an order through our e-commerce site, or call TSI at one of the numbers listed below.



UNDERSTANDING, ACCELERATED

TSI Incorporated - Visit our website www.tsi.com for more information.

 USA
 Tel: +1 800 874 2811

 UK
 Tel: +44 149 4 459200

 France
 Tel: +331 41 19 21 99

 Germany
 Tel: +49 241 523030

459200 Chin 92199 Sing 23030

©2019 TSI Incorporated

 India
 Tel: +91 80 67877200

 China
 Tel: +86 10 8219 7688

 Singapore
 Tel: +65 6595 6388

Printed in U.S.A.

Specifications subject to change without notice.

FLO-Sight is a trademark, and TSI and the TSI logo are registered trademarks of TSI Incorporated.